



## Ref: 1W10

 
Location: Courtroom, First Floor, Type Existing: Triple window. Single glazed metal

framed crittall window.

Proposed Works:
Burn off all paintwork and spot prime steelwork where corroded. Rake out and replace all defective putties. Existing opaque and textured glass to be removed and replaced with new clear float glass. Window and subframe to be prepared, with painted finish. Existing extraction fan to be removed and replaced with glass. New internal timber cill board.

Repair Code: Code: 3

Glazing: \*Single clear float glass to match existing windows



Courtroom, South Elevation, Ground

Type Existing: Perforated Metal

Burn off all defective paintwork and spot prime steelwork where corroded Window and subframe to be

prepared, with painted finish. Repair Code: Code: **2** Glazing:

Not required

Subframe/ surround: Subframe is to be retained prepared

and painted. Ironmongery:
to be refurbished and/ or replaced

where required. Finish:

Paint windows with 2no. coats. Colour: White - TBC External M60/120

Internal M60/120

L10/310

- Heavy corrosion to horizontal rail throughout, cracked and dead putties, peeling paint and 1no cracked pane of glass. Fixed unit

- Black Out Roller Blind required to fit within existing slot in window reveal



Subframe/ surround:

and painted.

Finish:

where required.

Subframe is to be retained prepared

#### Ref: GW06

Ironmongery:
to be refurbished and/ or replaced

Proposed Works:

Paint windows with 2no. coats: Colour: DARK GREEN / GREY - TBC External M60/120

Internal M60/120 Spec Reference: L10/

Comments: Heavy corrosion



## Ref: GW12

New Police Cells, South Elevation

Type Existing: Single glazed metal framed period crittall window.

Proposed Works:

Burn off all paintwork. Replace defective putties, wire brush corroded areas and spot prime areas of rust using zinc rich paint. Window and subframe to be prepared, with painted finish.

Repair Code: Code: 2 Glazing: Not required



#### Subframe/ surround:

Subframe is to be retained prepared and painted.

Ironmongery:

to be refurbished and/ or replaced

where required.

Paint windows + Bars with 2no. coats. Colour: White - TBC

External M60/120 Internal M60/120

Spec Reference:

L10/**310** 

Windows generally in fair condition although areas of corrosion occuring with cracked putties



### 1. Good - sound and operational - prepare surfaces and redecorate. 2. Intact - ease and free-up moving parts, address surface defects (or corrosion), adjust, redecorate. 3. Moderate - Requires repair, adjustment, refurbishment prior to redecoration. Poor - significant repairs, alterations or new components needed to make operational. Adjust, redecorate. Beyond ecomonic repair - remove. Prepare opening for replacement unit.

window repair codes

Ref:

Legend

# Window Key -**Guildhall Square South Elevation** as existing - 1:200 @ A1

all drawings are copyright do not scale drawing report all discrepancies to project administrator all dimensions to be checked on site

Stage 4 - Tender

T1: 31.01.19 - Draught Stripping Option Added + NBS Notation Updated

project title: <b>Tavistock Guildhall</b> and Police Station	date: October 2018	scale: 1:25@ A1 1:50 @ A3	drawn: cm
drawing title: External Window Repair Schedule 4 - South Elevation	job no: 1041	drawing no: C-358	rev:

gillespie yunnie architects

wer Tweed Mill Shinners Bridge Dartington Devon TQ9 6JB t 01803 860010 f 01803 864929 e info@gyarchite