

# Ref: 1W15

Location Trowtes House, First Floor Type Existing: Timber framed triple hung single glazed sash windows Proposed Works:

Rotten cill to be replaced in new hardwood, Rake out dead and defective putties and replace in linseed oil putty, cut out swollen joints and repair using window care repair if required Sash cords weights, staff beads & parting beads to be refurbished where required. Window and subframe to be prepared, with painted finish. Repair Code Code: 2

Glazing: Not required



### Ref: GW09 Location:

genera

Courtroom, Ground Floor Type Existing: Single glazed modern metal framed crittall window. Proposed Works:

Rake out all defective putties and replace in linseed oil putty, burn off all paintwork and spot prime corroded areas using zinc rich paint. Thoroughly clean down all paintwork to windows, overhaul and replace and re-grease all working mechanisms Window and subframe to be prepared, with painted finish. Existing external metal bars to be removed carefully, any damaged surrounds to be made good. Repair Code: Code: 2

all drawings are copyright do not scale drawing report all discrepancies to project administrato all dimensions to be checked on site



Subframe/ surround:

Colour: White - TBC

External M60/123

Internal M60/150

Spec Reference

Ironmongery:

required.

Finish:

L10/210

Comments

To all granite mullions and window

surrounds, strip back all paintwork.

to be refurbished and/ or replaced where

Paint windows with 2no. undercoats and

finish with 1no. gloss finishing coat

- Option A: No Draught Seals

brush seal to sash meeting rail.

- Option B: Draught Seal - weatherstrip around perimeter of sashes / recessed

- Black Out Boller Blind required to fit

within existing slot in window reveal

### Glazing: Not required Subframe/ surround: To all granite mullions and window surrounds, strip back all paintwork. Ironmongery: to be refurbished and/ or replaced where required. Finish:

Paint windows with 2no. coats. Colour: White - TBC External M60/120 Internal M60/120 Spec Reference: L10/**310** Comments Existing Stippled glass. Rendered and granite window surrounds. 2no. outlet pipes penetrating window surrounds to be removed



## Ref: 1W16

Location: Police Station, First floor Type Existing: Timber framed double hung single glazed sash windows Proposed Works: Rotten cill to be replaced in new hardwood, Rake out dead and defective putties and replace in linseed oil putty, cut out swollen joints and repair using window care repair if required. Sash cords, weights, staff beads & parting beads to be refurbished where required. Window and subframe to be prepared, with painted finish Repair Code: Code: 2 Glazing: Not required

Subframe/ surround: To all granite mullions and window surrounds, strip back all paintwork. Ironmongery: to be refurbished and/ or replaced where required. Finish: Paint windows with 2no. undercoats and finish with 1no. gloss finishing coat Colour: White - TBC External M60/123 Internal M60/150 Spec Reference: L10/**210** Comments - Option A: No Draught Seals - Option B: Draught Seal - weatherstrip around perimeter of sashes / recessed brush seal to sash meeting rail.

# Ref: GW13

Location: New Police cells, North Elevation Type Existing: Single glazed metal framed period crittall window. Proposed Works: Burn off all paintwork. Replace defective putties, wire brush corroded areas and spot prime areas of rust using zinc rich paint. Window and subframe to be prepared, with painted finish. Repair Code: Code: 2 Glazing: Not required



#### Subframe/ surround: Subframe is to be retained prepared and painted. Ironmongery: to be refurbished and / or replaced where required. Finish: Paint windows + Bars with 2no. coats Colour: White - TBC External M60/120 Internal M60/120 Spec Reference: L10/310 Comments: Minor missing areas of pointing above North window with isolated areas of pointing detaching. Rake out defective pointing and repoint in lime mortar.



## Ref: GW10

Not required

Location Courtroom, Ground Floor Type Existing: Timber framed single glazed window Proposed Works: Window to be replaced with louvres

#### for plantroom to M+E Specification and Architect Approval within existing timber subframe. Subframe to be prepared, with painted finish. External vertical metal bars over window to be carefully removed, any damaged surrounds to be made good. Repair Code: Code: 3 Glazing:

to be refurbished and/ or replaced where required. Finish: Paint windows with 2no. undercoats and finish with 1no. gloss finishing coat Colour: White - TBC external M60/120 internal M60/120 Spec Reference L10/650

Subframe/ surround:

To all granite mullions and window

surrounds, strip back all paintwork

Glazing:

Ironmongery:

Comments:

Louvres.



# Ref: GW11

Location: Courtroom, Ground Floor Type Existing: Timber framed single glazed window Proposed Works: Rotten cill to be replaced in new hardwood, Rake out dead and defective putties and replace in linseed oil putty, cut out swollen joints and repair using window care repair if required. Window and subframe to be prepared, with painted finish. External Vertical metal bars over window to be carefully removed, any damaged surrounds to be made good. Repair Code: Code: 3 Glazing: Not required



Glazing:

Not required

Ironmongery:

where required.

Colour: White - TBC

External M60/123

Internal M60/150

Spec Reference

L10/210

Comments

Fixed unit

Finish:

coat

Subframe/ surround:

To all granite mullions and window

surrounds, strip back all paintwork.

to be refurbished and/ or replaced

Paint windows with 2no. undercoats

and finish with 1no. gloss finishing

#### Ref: GW14 Location:

Trowtes House, Ground Floor Type Existing: Timber framed single glazed window Proposed Works: Rotten cill to be replaced in new hardwood, Rake out dead and defective putties and replace in linseed oil putty, cut out swollen joints and repair using window care repair if required. Window and subframe to be prepared, with painted finish. External metal bars over window to be carefully removed, any damaged surrounds to be made good. Repair Code: Code: 3 Glazing: Not required

Subframe/ surround: Ironmongery: where required. Finish: coat Colour: White - TBC External M60/123 Internal M60/150 Spec Referen L10/210 Comments

Glazing:

Not required

key Stage 4 - Tender \* NOTE: If window beads do not allow for the installation of standard float glass then 'Horticultural Glass' to be used.

T1: 31.01.19 - Draught Stripping Option Added + NBS Notation Updated + 1W15 Updated

Ref:	Legend		
	window repair codes		
1.	Good - sound and operational - prepare surfaces and redecorate.		
<b>2</b> .	Intact - ease and free-up moving parts, address surface defects (or corrosion), adjust, redecorate.		
3.	Moderate - Requires repair, adjustment, refurbishment prior to redecoration.		
4.	Poor - significant repairs, alterations or new components needed to make		
5.	operational. Adjust, redecorate. Beyond ecomonic repair - remove. Prepare opening for replacement unit.		





Tavistock Guildhall and Police Station	date: October 2018	scale: 1:25@ A1 1:50 @ A3	drawn: cm	
drawing title: External Window Repair Schedule 6 - East Elevation	job no: 1041	drawing no: C-360	<sup>rev:</sup>	
gillespie yunnie architects				
Lower Tweed Mill Shinners Bridge Dartington Devon TQ9 6JB t 01803	860010 f 01803 864	929 e info@gyarchit	ects.co.uk	